



# DSS-M15S 270° 15KG DF Metal Servo with Analog Feedback SKU: SER0044

DSS-M15S servos have been well received by customers in these years. It has extremely wide angle control range, huge load capacity and excellent quality. This DSS-M15S with analog feedback has broken its internal potentiometer signal. This is an analog signal with 0~3.3V feedback. You can connect it to MCU to realize close-loop feedback control.

DSS-M15S 270° Metal servo with feedback is compatible with Arduino Servo library. You can drive it with Arduino Board and read the angle value from analog side.

### **Specification**

Electronic specifications

• Operating voltage: 4.8-7.2V

• 6V test environment

• Operating speed (no load): 0.18 sec/60 degrees

• Resting current: 80mA

• Locking torque: 13.5KG\*cm

Stall current: 1.8AStandby current: 4mA7V test environment

• Operating speed (no load): 0.16sec/60 degrees

Resting current: 100mALocking torque: 15KG\*cm

Stall current: 2A

Standby current: 5mA

• Mechanical specifications

• Gear material: metal gear

• Operating angle: 270 degrees

• Wiring gauge: 28PVC

• Data line length: 320mm

• Gear bracket spline: 25T/5.80

• Gear ratio: 310:1

• Size: 54.5\*20\*47.5mm

Control specifications

Feedback signal: 0-3.3V

• Control signal: RC PWM


• Pulse range: 500-2500 us

• Median signal value: 1500us

• Clockwise rotation: <1500us

Control frequency: 50-330Hz (Arduion compatible)


#### **Servo Overview**

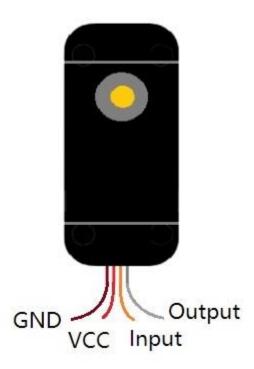

DSS-M15S 270° 15KG DF Metal Servo with Analog Feedback

Num	Label	Description
1	GND	GND
2	VCC	4.8~7.2V
3	INPUT	PPM Signal
4	OUTPUT	Analog feedback

# Relationship between Angle & Analog value

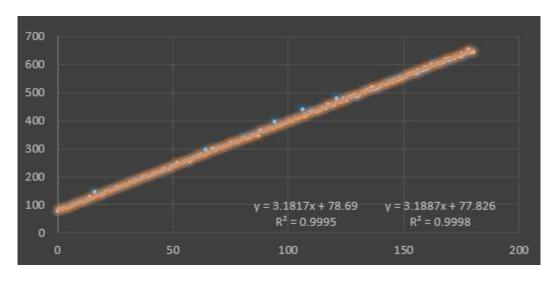

SER0044 Servo

Formula: Actual angle = Analog value degree \*0.47-33.4

#### **Before Usage**

There will be some error between each servos. If you want to use the servos with scenes that require precise control, you can calibrate them separately. A quick three-point calibration method is provided here:

- 1. Drive the servo to 90 degrees (1500us), record the actual angle as reference angle A, and record the corresponding feedback analog value a;
- 2. Drive the servo to 0 degrees (500us), record the actual angle as reference angle B, and record the corresponding feedback analog value B:
- 3. Drive the servo to 270 degrees (2500c), record the actual angle as reference angle C, and record the corresponding feedback analog value C

The following formula gives the relationship between Analog value & Angle:

- Actual angle = m \* Analog value + n
- m=[(A-B)/(a-b)+(C-A)/(c-a)]/2
- n=[(Ab-Ba)/(b-a)+(Bc-Cb)/(c-b)]/2


If you doesn't need such accurate value, you can use **m=0.47;n=-33.4** directly.

#### **Tutorial**

#### Requirements

- Hardware
- DFRduino UNO R3 (or similar) x 1 SER0044 DSS-M15S 270° Metal Servo
- M-M/F-M/F-F Jumper wires
- **Software**
- Arduino IDE, Click to Download Arduino IDE from Arduino®

#### **Connection Diagram**

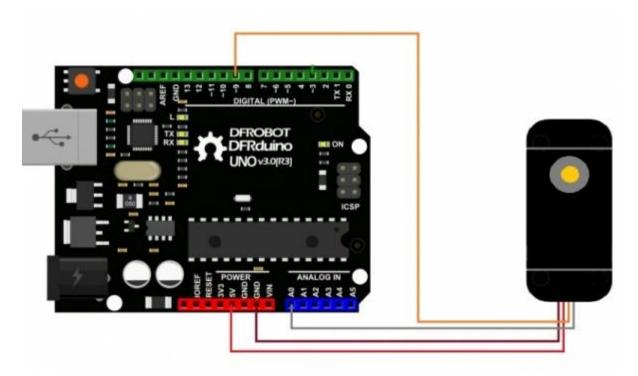

SER0044 Arduino Connection

#### **Sample Code**


```
void setup()
{
    Serial.begin(9600);//Set Baud Rate to 9600 bps
}

void loop()
{
    uint16_t val;
    double dat;
    val=analogRead(A0);//Connect Analog pin to A0
    dat = (double) val * 0.47-33.4;
    Serial.print("Position:"); //Display the position on Serial monitor
    Serial.print(dat);
    Serial.println("Degree");
    delay(100);
}
```

#### **Expected Results**

Arduino will drive the servo with D9 pin, and receive the Analog feedback from A0 port.

## **Dimension**

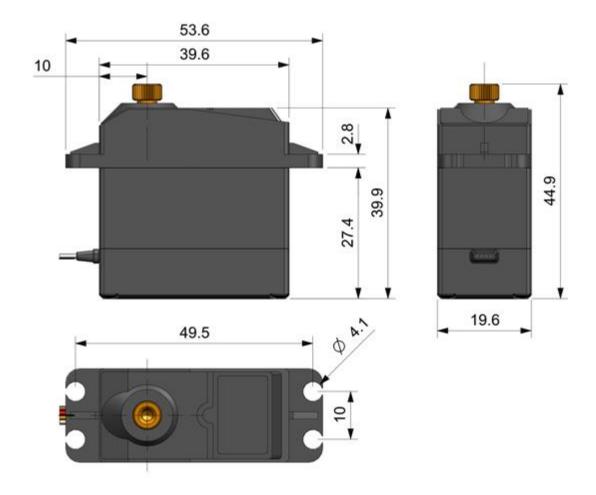

SER0044 Dimension